

HYDROTECHNICAL ASSESSMENT FOR CNRL PIPELINES, WORKMAN'S DAM AREA (SOURIS RIVER), OXBOW, SASKATCHEWAN

Prepared for:



Canadian Natural Resources Limited
206 Souris Avenue
Estevan, Saskatchewan
Canada S4A 1J7

Prepared by:

D.P. van Zeyl, M.Sc., P.Geo.
J.D. Mollard and Associates (2010) Limited
2215-A Emmett Hall Road
Regina, Saskatchewan
Canada S4N 2Y3



TABLE OF CONTENTS

1	INTRODUCTION.....	1
2	METHODS.....	1
3	RESULTS.....	3
3.1	FIELD OBSERVATIONS	3
3.1.1	NOTES ON WATER LEVELS	3
3.2	FLOOD HISTORY.....	4
3.3	HISTORICAL AIR PHOTO ANALYSIS	7
3.4	DEPTH OF COVER SURVEYS	10
3.4.1	SEGMENT 1 – SOURIS RIVER SEGMENT	10
3.4.2	SEGMENT 2 – MEANDER NECK SEGMENT	14
3.4.3	SEGMENT 3 – RAVINE SEGMENT	16
3.4.4	SEGMENTS 4 AND 5 – RAVINE SEGMENTS	18
3.5	SOURIS RIVER TRANSECTS	18
3.5.1	TRANSECTS 1+203, 1+190 AND 1+181.....	18
3.5.2	TRANSECTS 1+160, 1+150 AND 1+134.....	20
3.5.3	TRANSECTS 1+114, 1+100 AND 1+087.....	21
4	HAZARD AND RISK ASSESSMENT	22
4.1	SEGMENT 1 – SOURIS RIVER CHANNEL CROSSING.....	22
4.1.1	HAZARD AND RISK INTERPRETATION.....	22
4.1.2	RECOMMENDATIONS	23
4.2	SEGMENT 2 – SOURIS RIVER MEANDER NECK CROSSING	23
4.2.1	HAZARD AND RISK INTERPRETATION.....	23
4.2.2	RECOMMENDATIONS	24
4.3	SEGMENT 3 – RAVINE CROSSING	24
4.3.1	HAZARD AND RISK INTERPRETATION.....	24
4.3.2	RECOMMENDATIONS	24
4.4	SEGMENTS 4 AND 5 – RAVINE CROSSINGS	25
4.4.1	HAZARD AND RISK INTERPRETATION.....	25
4.4.2	RECOMMENDATIONS	25
5	CLOSURE.....	26
	APPENDIX A – AERIAL OBLIQUE PHOTOS	27
	APPENDIX B – GROUND PHOTOS ALONG RAVINE	32
	APPENDIX C – ARCHIVAL MAP IMAGERY.....	40
	APPENDIX D – DEPTH OF COVER DATA.....	46



Figure 1 Overview August 2017 satellite image map.



Figure A1 Aerial oblique photo showing overview of numbered flowline segments (14 Jul 2021).
View northwest



Figure A2 Aerial oblique photo showing river reach surrounding segment 1 (14 Jul 2021).
View east-northeast



Figure A3 Aerial oblique photo showing flowline segment 2 and surroundings (14 Jul 2021).
View northwest



Figure A4 Aerial oblique photo showing flowline segment 2 and surroundings (14 Jul 2021).
View southeast

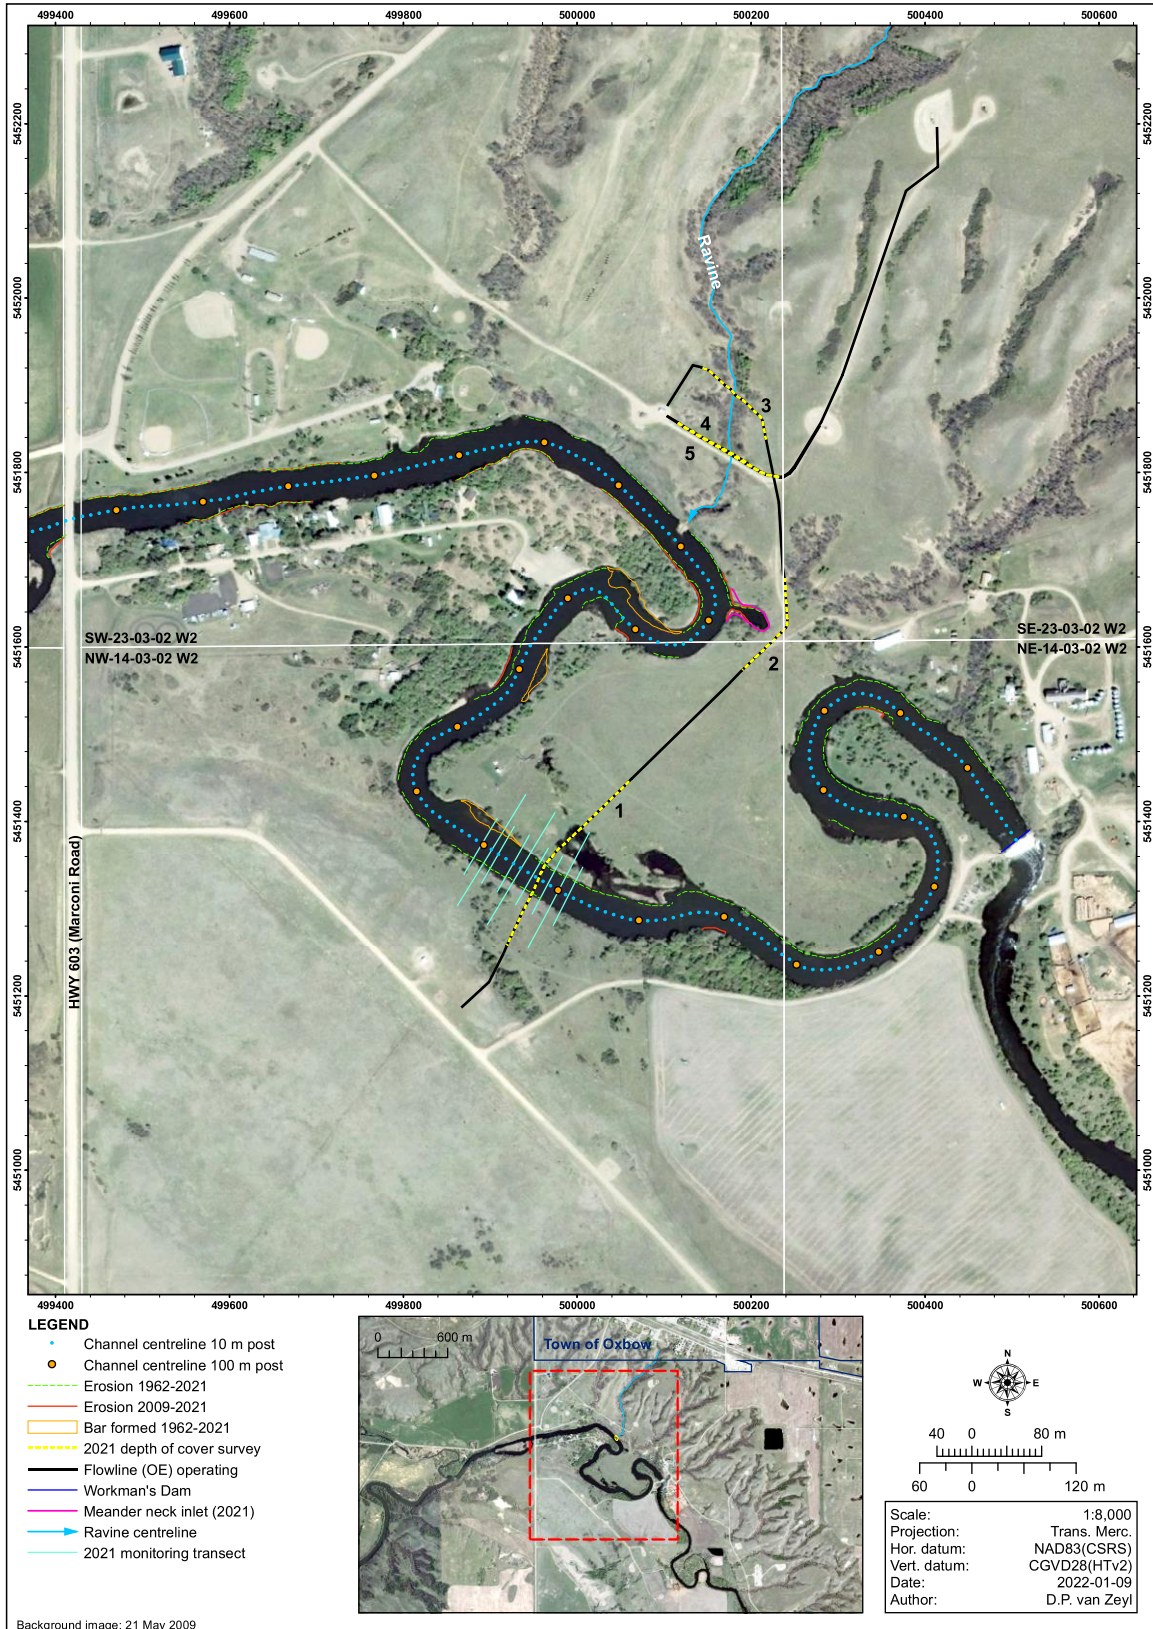


Figure C5 Overview May 2009 aerial image map.